

## [ 4 ] 汚染促進試験方法（概要版）

### 1 . 試験板の調整方法

JIS K-5675 1・2・3級を表面調整した鋼板に塗料メーカーが指定した塗装系、膜厚で塗装する。

2 - 1 . 汚染促進試験に使用する汚染物質の種類と配合は以下のとおり。

	No.1	No.2	No.3	NO.4
	Soot	Dust	Salts	Particulate Organic Matter
重量比	5%	47%	20%	28%

### 2 - 2 . 汚染方法

#### 1 ) QUV 照射

24 時間 合計(3 cycles)

1 サイクル=4 時間 UVB-313 0.63W/m<sup>2</sup>/nm (60°C) ⇒ 4 時間 水環境 (50°C)

3 サイクル終了後にオープン (60°C) で 1 時間乾燥。

#### 2 ) 汚染溶液塗布条件

塗板の大きさ	7×15cm
ノズル口径	1.0mm
吹付空気圧力	3.0kgf/cm <sup>2</sup>
塗布量(g/分)	300cc
使用空気量	230L/分
塗布時間	30 秒
塗板と吐出口の距離	15cm

#### 3 ) 汚染物質の洗浄/乾燥

##### 洗浄条件

ノズル口径	1.0mm
吹付空気圧力	3.0kgf/cm <sup>2</sup>
水吹付量(g/分)	300cc
水洗時間	10 分
塗板と吐出口の距離	15cm

オープン (60°C、1 時間) で乾燥させた後、室温まで放冷。

### 3. 評価方法

- 1) 初期評価：反射率（JIS K 5602 300～2,500nm）を測定する。測定箇所3点（上部、中央部、下部）とし、平均をとる。
- 2) 洗浄後の評価 JIS K 5602（塗膜の日射反射率の求め方）に従い、日射反射率（波長範囲300～2,500nm）の測定を行う。

原状試験片と促進試験後の試験片との日射反射率（波長範囲300～2,500nm）を測定する。

参考資料 汚染促進試験方法の策定にあたり参考としたASTM D 7897-15を次に示す。

1.Weathering-apparatus exposure before soiling	24h total(2 cycles) 1 cycle=8h UVA-340 at 0.89W/m <sup>2</sup> /nm and 60°C 4h water condensation at 50°C Air dry (room temperature 15-25°C)
2.Soiling	Spray aqueous mix of dust, salt, organic matter, and soot Deposit wet mass of 8±1mg/cm <sup>2</sup> Dry under infrared lamp (surface temperature 80°C >dried for 2-10min)
3.Weathering-apparatus exposure after soiling	24h total(2 cycles) 1 cycle=8h UVA-340 at 0.89W/m <sup>2</sup> /nm and 60°C 4h water condensation at 50°C Dry under infrared lamp (surface temperature 80°C dried for 2-10min)